


CATERPILLAR D7G

Description

Caterpillar D7G, Engine brand Caterpillar, 3306, Air conditioning, Erops cabin, Straight tilt blade, Width of the blade 3.78m, Multi shank ripper, Width of the pads 560mm, In good and clean condition.

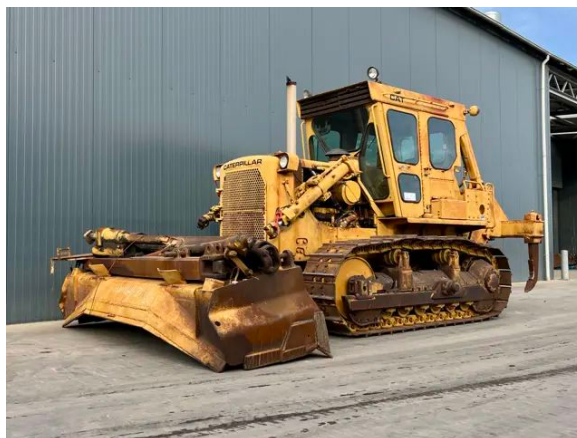

Year	1984
Hours	25200
Weight	22.000 kg
Serial number	92V12207
Reference	206242

[Download photos](#)


CONTACT US:
SALES@SMITMA.COM
+31(0)773999840

New/Excellent
★★★★★

Very good
★★★★☆

Good
★★★☆☆

Fair
★★★☆☆

Poor
★★★☆☆

INSPECTION REPORT

FEATURES

Engine brand	Caterpillar
Engine model	3306
Air conditioning	✓
Erops cabin	✓
Blade	Straight tilt blade
Width of the blade	3.78m
Ripper or valve	Multi shank ripper
Width of the pads	560mm
Overall condition	In good and clean condition.

GENERAL APPEARANCE

Paint	★ ★ ★ ★ ★
Decals	★ ★ ★ ★ ★
Bonnet	★ ★ ★ ★ ★
Engine cover doors	★ ★ ★ ★ ★
Chassis	★ ★ ★ ★ ★
Grab irons	★ ★ ★ ★ ★
Cabin	★ ★ ★ ★ ★
Belly plate	★ ★ ★ ★ ★
Pre-cleaner bowl	★ ★ ★ ★ ★

ENGINE DETAILS AND CONDITION

Engine number	08Z20771
Arrangement number	1W0543
Air cleaner	Clean
Anti-freeze level °C	-15°C
Diesel anti-freeze added	Yes
Diesel level ok	Yes
Cooling liquid level ok	Yes
Engine oil level ok	Yes
Exhaust manifold	★ ★ ★ ★ ★
Muffler	★ ★ ★ ★ ★
Exhaust stack	★ ★ ★ ★ ★
Engine supports	★ ★ ★ ★ ★
Hoses	★ ★ ★ ★ ★

Good cold start	Yes
Engine power	★★★★★
Blow by	★★★★★
Knocking	No
Compression in the radiator	No
Water in the oil	No
Oil in the water	No
Smoke	Normal
Engine leaks	No
Belts and pulleys	★★★★★
Fan	★★★★★
Radiator	★★★★★

UNDERCARRIAGE LEFT IN LIFE IN %

Overall condition	90%
Chains	100%
Bushings	100%
Sprockets	100%
Idlers	100%
Bottom rollers	100%
Top rollers	100%
Track pads	50%

OPERATOR STATION

Hourmeter	Not Working
Air conditioning	Not Working
Heater	Not Working
Gauges	Few don't work
Switches	★★★★★
Warning	No Warnings Available
Cabin glass	Not broken
Windshield wipers	Few don't work
Interior lights	Working
Cabin floor	★★★★★
Interior roof	★★★★★
Seat	★★★★★

STEERING

Steering operating condition	★★★★★
------------------------------	-------

FRAME AND BLADE

Moldboard skin	★★★★★
Cutting edge	★★★★★
Play dozer frame	★★★★★
Play blade pin	★★★★★
Play push arms	★★★★★
Play lift cylinder	★★★★★
Lift cylinders leaking	No
Play tilt cylinder	★★★★★
Tilt cylinder leaking	No
Play equaliser bar	★★★★★
Cracks or welds	Yes

RIPPER

Play ripper	★★★★★
Cylinders leaking	No
Ripper frame	★★★★★
Number of ripper shanks	2

HYDRAULICS

Hydraulic oil level ok	Yes
Hydraulic lines and fittings	★★★★★
Hydraulic tank/sight glass and cap	★★★★★
Hydraulic valves leaking	No
Noise hydraulic pump normal	Yes
Operating condition hydraulics	★★★★★

BRAKE

Service brake operation	★★★★★
-------------------------	-------

DRIVE TRAIN/TRANSMISSION

Transmission fully operational in all gears forward and reverse	Yes
Transmission oil level ok	Yes
Transmission noisy	No
Oil level left final drive ok	Yes
Oil level right final drive ok	Yes
Drive chain leaks	No

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator functioning	Yes
Wiring	★★★★★
Batteries	★★★★★
Starter	★★★★★
Cabin lights working	Few lights don't work

SAFETY ITEMS

Backup alarm	Not Working
Seat belt	Available
Horn	Working

New/Excellent
★★★★★

Very good
★★★★★

Good
★★★★★

Fair
★★★★★

Poor
★★★★★

Copyright Smilma BV

TRUSTED

SINCE 1960

PARTNER