

CATERPILLAR 950H


Description

Caterpillar 950H, Engine and model Caterpillar C7DI, 146 kW, CE, Erops cabin, 23.5R25 90% , GP bucket with welded edge, Width of the bucket 3.03m, Complete steering wheel, Ride control, Autoshift, Backup camera, Hours certified by Caterpillar, In good and clean condition.



Year	2007
Hours	12970
Weight	18.500 kg
Serial number	CAT0950HCN1A01701
Reference	211673

[Download photos](#)

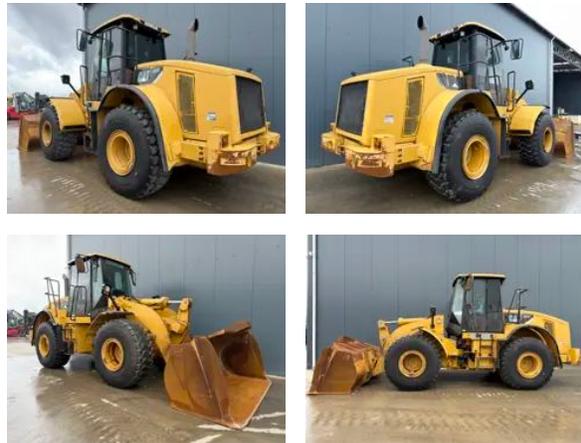

CONTACT US:
SALES@SMITMA.COM
+31(0)773999840

New/Excellent ★★★★★	Very good ★★★★☆	Good ★★★☆☆	Fair ★★★☆☆	Poor ★★☆☆☆
------------------------	--------------------	---------------	---------------	---------------



INSPECTION REPORT

FEATURES

Engine and model	Caterpillar C7DI
Engine power	146 kW
CE	✓
Erops cabin	✓
Tyre size	23.5R25 90%
Bucket	GP bucket with welded edge
Width of the bucket	3.03m
Steering	Complete steering wheel
Ride control	✓
Autoshift	✓
Hours	Hours certified by Caterpillar
Overall condition	In good and clean condition.

DOCUMENTS

Parts book	✓
Operation manual	✓

GENERAL APPEARANCE

Stamped serial number checked	Yes
Serial number plate checked	Yes
Paint	★★★★☆☆
Decals	★★★★☆☆
Bonnet	★★★★☆☆
Chassis	★★★★☆☆
Steps/ladders	★★★★☆☆
Grab irons	★★★★☆☆
Cabin	★★★★☆☆
Pre-cleaner bowl	★★★★☆☆
Toolbox	★★★★☆☆

ENGINE DETAILS AND CONDITION

Engine number	C7C08739
Arrangement number	235-1422
Air cleaner	Clean
Anti-freeze level °C	-41°C

Diesel anti-freeze added	Yes
Diesel level ok	Yes
Cooling liquid level ok	Yes
Engine oil level ok	Yes
Exhaust manifold	★★★★★
Muffler	★★★★★
Exhaust stack	★★★★★
Engine supports	★★★★★
Hoses	★★★★★
Good cold start	Yes
Engine power	★★★★★
Blow by	★★★★★
Knocking	No
Compression in the radiator	No
Water in the oil	No
Oil in the water	No
Smoke	Normal
Engine leaks	No
Belts and pulleys	★★★★★
Fan	★★★★★
Radiator	★★★★★

OPERATOR STATION

Hourmeter	Working, hours certified by Caterpillar
Air conditioning	Not working
Heater	Working
Gauges	Working
Switches	★★★★★
Display	★★★★★
Warning	No warnings available
Mirrors	Small crack no need to repair
Cabin glass	Not broken
Windshield wipers	Working
Interior lights	Working
Cabin floor	★★★★★
Interior roof	★★★★★
Seat	★★★★★
Door lock	Working

BUCKET

Overall condition of the bucket	★★★★★
Bottom	★★★★★
Sides	★★★★★
Cutting edge	★★★★★

FRAME

Play articulation point	★★★★★
Note: Steering cylinders little play	
Play loading frame	★★★★★
Play bucket pins	★★★★★
Crack or welds	No

HYDRAULICS

Hydraulic oil level ok	Yes
Hydraulic lines and fittings	★★★★★
Hydraulic tank/sight glass and cap	★★★★★
Hydraulic valves leaking	No
Noise hydraulic pump normal	Yes
Operating condition hydraulics	★★★★★

BRAKE

Service brake operation	★★★★★
Parking brake operation	★★★★★

DRIVE TRAIN/TRANSMISSION

Transmission fully operational in all gears forward and reverse	Yes
Transmission oil level ok	Yes
Transmission noisy	No
Oil level front axle ok	Yes
Oil level rear axle ok	Yes

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator functioning	Yes
Wiring	★★★★★
Batteries	★★★★★
Starter	★★★★★
Cabin lights working	Yes

Tail lights working	Yes
Additional work lights working	Few lights don't work

SAFETY ITEMS

Seat belt	Available
Horn	Working

TYRES

FRONT LEFT

Tread dept in mm	30mm
Percentage life remaining	90%

REAR LEFT

Tread dept in mm	30mm
Percentage life remaining	90%

REAR RIGHT

Tread dept in mm	30mm
Percentage life remaining	90%

FRONT RIGHT

Tread dept in mm	30mm
Percentage life remaining	90%

New/Excellent



Very good



Good



Fair



Poor

