


INSPECTION REPORT

CATERPILLAR 330 07A

The Caterpillar 330 07A is a powerful and efficient excavator that combines advanced technology with rugged durability. It is equipped with a Caterpillar C7.1 engine producing 205kW and conforming to EPA and CE standards, meeting the Step 4 Final emission level. This machine offers features such as air conditioning, central lubrication, a backup camera, and an immobilizer for enhanced security and comfort. Its digging bucket features teeth and is piped for hammer use, ensuring versatile and productive operation. With a mono boom measuring 6.15 meters and a stick length of 3.20 meters, this excavator is well-suited for a variety of digging tasks. The Caterpillar 330 07A is in very good and clean condition, certified by Caterpillar, making it a reliable choice for demanding work environments.

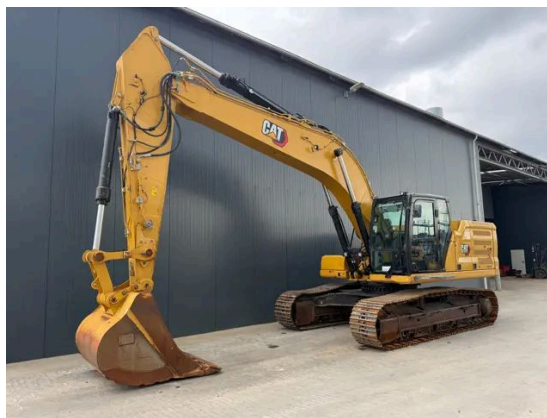

Specifications

Year	2019
Hours	9354
Weight	30.800 kg
Serial number	CAT00330VPFN00314
Reference	214084

Features

Engine brand and model	Caterpillar C7.1
Engine power in kW	205kW
EPA	EPA
CE	✓
Emission level	Step 4 Final
Air conditioning	✓
Width of the pads	600mm
Boom	Mono boom
Length of the mono boom	6.15m
Length of the stick	3.20m
Bucket	Digging bucket with teeth
Width of the bucket	1.45m
Piped	Piped for hammer
AM/FM Radio	✓
Hours	Hours certified by Caterpillar
Overall condition	In very good and clean condition.

Documents

Parts book	✓
Operation manual	✓

General Appearance

Stamped serial number checked	Yes
Serial number plate checked	Yes
Code immobilizer	0314
Paint	★★★★★
Body work	★★★★★
Decals	★★★★★
Bonnet	★★★★★
Engine cover doors	★★★★★
Chassis	★★★★★
Bottom plates	★★★★★
Counter weight	★★★★★
Toolbox	★★★★★
Steps/ladders	★★★★★
Grab irons	★★★★★
Cabin	★★★★★
Pre-cleaner bowl	★★★★★
Central greasing working	Yes
Cracks or welds	Yes
Reinforcement applied stick	

Engine Details And Condition

Engine number	D8T47866
Arrangement number	550-4387
EPA sticker available	Yes
Air cleaner	Clean
Anti-freeze level °C	-36°C
Diesel anti-freeze added	Yes
Diesel level ok	Yes
Cooling liquid level ok	Yes
Engine oil level ok	Yes
Exhaust manifold	★★★★★
Muffler	★★★★★
Exhaust stack	★★★★★
Engine supports	★★★★★
Hoses	★★★★★
Good cold start	Yes
Engine power	★★★★★
Blow by	★★★★★
Knocking	No
Compression in the radiator	No
Water in the oil	No
Oil in the water	No
Smoke	Normal
Engine leaks	No
Belts and pulleys	★★★★★
Fan	★★★★★
Radiator	★★★★★
Ad blue	✓

Bucket

Overall condition of the bucket	★★★★★
Bottom	★★★★★
Sides	★★★★★
Teeth	★★★★★

Undercarriage Left In Life In %

Overall condition	80%
Chains	80%
Bushings	80%
Sprockets	70%
Idlers	80%
Bottom rollers	70%
Top rollers	90%
Track pads	80%

Safety Items

Backup camera	Working
Seat belt	Available
Horn	Working

Operator Station

Hourmeter	Working, hours certified by Caterpillar
Air conditioning	Working
Heater	Working
Gauges	Working
Switches	★★★★★
Display	★★★★★
Warning	No warnings available
Mirrors	Not broken
Cabin glass	Not broken
Windshield wipers	Working
Interior lights	Working
Cabin floor	★★★★★
Interior roof	★★★★★
Seat	★★★★★

Hydraulics

Hydraulic oil level ok	Yes
Hydraulic lines and fittings	★★★★★
Hydraulic tank/sight glass and cap	★★★★★
Travel motors	★★★★★
High and low travel speed working	Working
Oil level left final drive ok	Yes
Left final drive leaking	No
Oil level right final drive ok	Yes
Right final drive leaking	No
Hydraulic valves leaking	No
Noise hydraulic pump normal	Yes
Operating condition hydraulics	★★★★★

Boom And Stick

Play lift cylinder	★★★★★
Lift cylinders leaking	No
Play boom pen	★★★★★
Play stick cylinder	★★★★★
Stick cylinder leaking	No
Play stick pen	★★★★★
Play bucket cylinder	★★★★★
Bucket cylinder leaking	No
Play bucket link	★★★★★
Play bucket pen	★★★★★
Condition monoboom	★★★★★
Condition stick	★★★★★

Swing Circle

Play on the swing bearing	★★★★★
Swing gear	★★★★★
Swing drive oil level ok	Yes
Swing drive leaking	No
Swing brake operating	Yes
Swing noise normal	Yes
Hydraulic swivel leaking	No
Operating condition	★★★★★

Electrical, Starting And Charging System

Alternator functioning	Yes
Wiring	★★★★★
Batteries	★★★★★
Starter	★★★★★
Cabin lights working	Yes
Additional work lights working	Yes