


CATERPILLAR 953 - RIPPER

Description

Caterpillar 953, Engine Caterpillar , 3204DI, Erops cabin, GP bucket with teeth, Width of the bucket 2.40m, In good and clean condition.

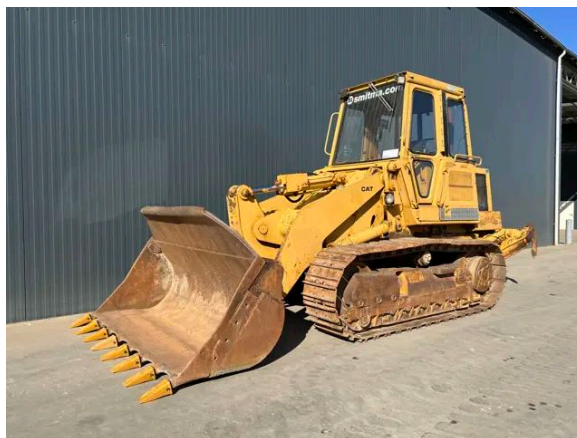

Year	1986
Hours	13936
Weight	15.079 kg*
Serial number	20Z00567
Reference	206459

[Download photos](#)


CONTACT US:
SALES@SMITMA.COM
+31(0)773999840

New/Excellent
★★★★★

Very good
★★★★☆

Good
★★★☆☆

Fair
★★★☆☆

Poor
★★★☆☆

INSPECTION REPORT

FEATURES

Engine	Caterpillar
Engine model	3204DI
Erops cabin	✓
Bucket	GP bucket with teeth
Width of the bucket	2.40m
Overall condition	In good and clean condition.

DOCUMENTS

Parts book	✓
Operation manual	✓

GENERAL APPEARANCE

Stamped serial number checked	Yes
Serial number plate checked	Yes
Paint	★★★★★
Decals	★★★★★
Bonnet	★★★★★
Engine cover doors	★★★★★
Chassis	★★★★★
Steps/ladders	★★★★★
Grab irons	★★★★★
Cabin	★★★★★
Pre-cleaner bowl	★★★★★

ENGINE DETAILS AND CONDITION

Engine number	45V51046
Arrangement number	1W1356
Air cleaner	Clean
Anti-freeze level °C	-39°C
Diesel anti-freeze added	Yes
Diesel level ok	Yes
Cooling liquid level ok	Yes
Engine oil level ok	Yes
Exhaust manifold	★★★★★
Muffler	★★★★★

Exhaust stack	★★★★★
Engine supports	★★★★★
Hoses	★★★★★
Good cold start	Yes
Engine power	★★★★★
Blow by	★★★★★
Knocking	No
Compression in the radiator	No
Water in the oil	No
Oil in the water	No
Smoke	Normal
Engine leaks	No
Belts and pulleys	★★★★★
Fan	★★★★★
Radiator	★★★★★

UNDERCARRIAGE LEFT IN LIFE IN %

Overall condition	40%
Chains	60%
Bushings	40%
Sprockets	20%
Idlers	60%
Bottom rollers	20%
Top rollers	60%
Track pads	50%

OPERATOR STATION

Hourmeter	Working
Heater	Working
Switches	★★★★★
Cabin glass	Not broken
Windshield wipers	Few don't work
Interior lights	Working
Cabin floor	★★★★★
Interior roof	★★★★★
Seat	★★★★★

BUCKET

Overall condition of the bucket	★★★★★
---------------------------------	-------

Bottom	★★★★★
Sides	★★★★★
Teeth	★★★★★

FRAME

Play articulation point	★★★★★
Play loading frame	★★★★★
Play bucket pins	★★★★★
Cracks or welds	Yes
Note: Drukstuk	

HYDRAULICS

Hydraulic oil level ok	Yes
Hydraulic lines and fittings	★★★★★
Hydraulic tank/sight glass and cap	★★★★★
Hydraulic valves leaking	No
Noise hydraulic pump normal	Yes
Operating condition hydraulics	★★★★★

BRAKE

Service brake operation	★★★★★
-------------------------	-------

TRANSMISSION

Transmission oil level ok	Yes
Transmission noisy	No
Oil level rear left final drive ok	Yes
Oil level rear right final drive ok	Yes
Drivetrain leaks	No

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator functioning	Yes
Wiring	★★★★★
Batteries	★★★★★
Starter	★★★★★
Cabin lights working	Few lights don't work

SAFETY ITEMS

Seat belt	Available
Horn	Working

New/Excellent ★★★★★	Very good ★★★★☆	Good ★★★☆☆	Fair ★★★☆☆	Poor ★☆☆☆☆
------------------------	--------------------	---------------	---------------	---------------

Copyright Smilma BV

