

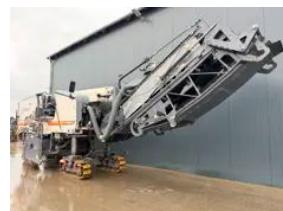
WIRTGEN W200I

Description

Wirten W200i, Cummins , QSX15, 447kW, CE, Width of the milling drum 2,00m, Milling depth 330mm, Standard milling drum, Flexible cutter system, Foldable conveyor belt, 2 slope & 1 grade control, Hydraulic lifting receiving conveyor, Hydraulic lifting side plates, Vacuum cutting system, Anti slip control, Camera system, Backup alarm, Pressure cleaner, Genuine hours, In very good and very clean condition.



Year	2018
Hours	4766
Weight	27.630 kg
Serial number	1420.1432
Reference	209836

[Download photos](#)

CONTACT US:

SALES@SMITMA.COM

+31(0)773999840

New/Excellent
★★★★★

Very good
★★★★☆

Good
★★★★☆

Fair
★★☆☆☆

Poor
★☆☆☆☆



INSPECTION REPORT

FEATURES

Engine brand	Cummins
Engine model	QSX15
Engine power in kW	447kW
CE	✓
Width of the milling drum	2,00m
Milling depth	330mm
Type of milling drum	Standard milling drum
Conveyor belt	Foldable conveyor belt
Hydraulic lifting receiving conveyor	✓
Hydraulic lifting side plates	✓
Camera system	✓
Backup alarm	✓
Hours	Genuine hours
Overall condition	In very good and very clean condition.

DOCUMENTS

Parts book	✓
Operation manual	✓

GENERAL APPEARANCE

Stamped serial number checked	Yes
Serial number plate checked	Yes
Paint	★★★★☆
Decals	★★★★☆
Bonnet	★★★★★
Engine cover doors	★★★★★
Chassis	★★★★★
Steps/ladders	★★★★☆

ENGINE DETAILS AND CONDITION

Engine number	7030080
Air cleaner	Clean
Anti-freeze level °C	-28°C
Diesel anti-freeze added	Yes
Diesel level ok	Yes

Cooling liquid level ok	Yes
Engine oil level ok	Yes
Exhaust manifold	★★★★★☆
Muffler	★★★★★☆
Exhaust stack	★★★★★☆
Engine supports	★★★★★☆
Hoses	★★★★★☆
Good cold start	Yes
Engine power	★★★★★☆
Blow by	★★★★★☆
Knocking	No
Compression in the radiator	No
Water in the oil	No
Oil in the water	No
Smoke	Normal
Engine leaks	No
Belts and pulleys	★★★★★☆
Fan	★★★★★☆
Radiator	★★★★★☆

WATERPUMP

Waterpump working	Yes
-------------------	-----

OPERATOR STATION

Hourmeter	Working
Gauges	Working
Switches	★★★★★☆
Display	★★★★★☆
Warning	No Warnings Available
Mirrors	Not broken
Seat	★★★★★☆

POWER BELT

Power belt	★★★★★☆
Tensioner	★★★★★☆
Pulleys	★★★★★☆

DRUM

Toolholders	★★★★★☆
Picks	★★★★★☆

HYDRAULICS

Hydraulic oil level ok	Yes
Hydraulic lines and fittings	★★★★★
Hydraulic tank/sight glass and cap	★★★★★
Hydraulic valves leaking	No
Noise hydraulic pump normal	Yes
Operating condition hydraulics	★★★★★

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator functioning	Yes
Wiring	★★★★★
Batteries	★★★★★
Starter	★★★★★
Additional work lights working	Few lights don't work

SAFETY ITEMS

Backup alarm	Working
Backup camera	Working
Horn	Working

UNDERCARRIAGE**FRONT LEFT**

Overall condition	75%
Chains	70%
Bushings	70%
Sprockets	60%
Idlers	70%
Bottom rollers	70%
Track pads	80%

REAR LEFT

Overall condition	75%
Chains	70%
Bushings	70%
Sprockets	60%

Idlers	70%
Bottom rollers	70%
Track pads	80%
REAR RIGHT	
Overall condition	75%
Chains	70%
Bushings	70%
Sprockets	60%
Idlers	70%
Track pads	80%
FRONT RIGHT	
Overall condition	75%
Chains	70%
Bushings	70%
Sprockets	60%
Idlers	70%
Bottom rollers	70%
Track pads	80%

CONVEYOR BELT

SMALL CONVEYOR

Belt	★★★★★
Frame	★★★★★
Rollers	★★★★★

LARGE CONVEYOR

Belt	★★★★★
Frame	★★★★★
Rollers	★★★★★

New/Excellent	Very good	Good	Fair	Poor
★★★★★	★★★★★	★★★★★	★★★★★	★★★★★

