


CATERPILLAR 980M - DUTCH MACHINE

Description

Caterpillar 980M, Engine and model Caterpillar C13, 313 kW, CE, Air conditioning, Erops cabin, 29.5R25, GP bucket with bolt on edge, Width of the bucket 3.59m, Joy stick control, Ride control, Autoshift, Backup camera, Backup alarm, Weight load indicator available but not tested, Cental lubrication available but not tested, Beacon, AM/ FM radio, Hours certified by Caterpillar, In very good and very clean condition.

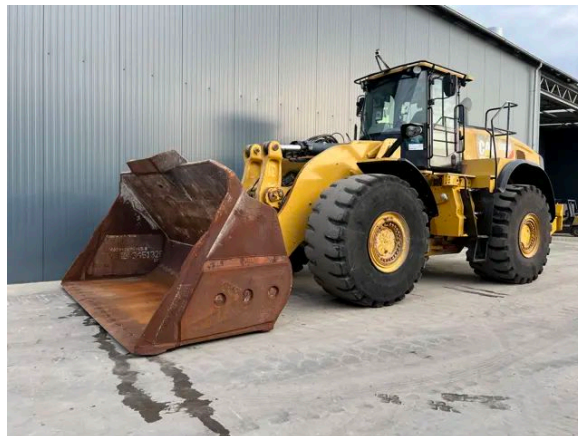

Year	2018
Hours	15467
Weight	29500 kg
Serial number	CAT0980MCMK210621
Reference	209508

[Download photos](#)


CONTACT US:
SALES@SMITMA.COM
+31(0)773999840

New/Excellent
★★★★★

Very good
★★★★☆

Good
★★★☆☆

Fair
★★★☆☆

Poor
★★★☆☆

Copyright Smitma BV



INSPECTION REPORT

FEATURES

Engine and model	Caterpillar C13
Engine power	313 kW
CE	✓
Erops cabin	✓
Tyre size	29.5R25
Bucket	GP bucket with bolt on edge
Width of the bucket	3.59m
Steering	Joy stick control
Ride control	✓
Autoshift	✓
Central lubrication	Cental lubrication available but not tested
Beacon	✓
Hours	Hours certified by Caterpillar
Overall condition	In very good and very clean condition.

DOCUMENTS

Parts book	✓
Operation manual	✓

GENERAL APPEARANCE

Stamped serial number checked	Yes
Serial number plate checked	Yes
Paint	★★★★★
Decals	★★★★★
Bonnet	★★★★★
Engine cover doors	★★★★★
Chassis	★★★★★
Steps/ladders	★★★★★
Grab irons	★★★★★
Cabin	★★★★★
Pre-cleaner bowl	★★★★★
Toolbox	★★★★★

ENGINE DETAILS AND CONDITION

Engine number	T4F11911
---------------	----------

Arrangement number	548-4359
Air cleaner	Clean
Anti-freeze level °C	-47°C
Diesel anti-freeze added	Yes
Diesel level ok	Yes
Cooling liquid level ok	Yes
Engine oil level ok	Yes
Exhaust manifold	★★★★★
Muffler	★★★★★
Exhaust stack	★★★★★
Engine supports	★★★★★
Hoses	★★★★★
Good cold start	Yes
Engine power	★★★★★
Blow by	★★★★★
Knocking	No
Compression in the radiator	No
Water in the oil	No
Oil in the water	No
Smoke	Normal
Engine leaks	No
Belts and pulleys	★★★★★
Fan	★★★★★
Radiator	★★★★★

OPERATOR STATION

Hourmeter	Working, hours certified by Caterpillar
Air conditioning	Working
Heater	Working
Gauges	Working
Switches	★★★★★
Display	★★★★★
Warning	No warnings available
Mirrors	Not broken
Cabin glass	Not broken
Windshield wipers	Working
Interior lights	Not working
Cabin floor	★★★★★
Interior roof	★★★★★

Seat	★★★★★
Door lock	Working
BUCKET	
Overall condition of the bucket	★★★★★
Bottom	★★★★★
Sides	★★★★★
Cutting edge	★★★★★
FRAME	
Play articulation point	★★★★★
Play loading frame	★★★★★
Play bucket pins	★★★★★
Crack or welds	No
HYDRAULICS	
Hydraulic oil level ok	Yes
Hydraulic lines and fittings	★★★★★
Hydraulic tank/sight glass and cap	★★★★★
Hydraulic valves leaking	No
Noise hydraulic pump normal	Yes
Operating condition hydraulics	★★★★★
BRAKE	
Service brake operation	★★★★★
Parking brake operation	★★★★★
Compressor	★★★★★
DRIVE TRAIN/TRANSMISSION	
Transmission fully operational in all gears forward and reverse	Yes
Transmission oil level ok	Yes
Transmission noisy	No
Oil level front axle ok	Yes
Oil level rear axle ok	Yes
Oil level front left final drive ok	Yes
Oil level rear left final drive ok	Yes
Oil level rear right final drive ok	Yes
Oil level front right final drive ok	Yes
Drivetrain leaks	No

ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator functioning	Yes
Wiring	★★★★★
Batteries	★★★★★
Starter	★★★★★
Cabin lights working	Yes
Tail lights working	Yes
Additional work lights working	Yes

SAFETY ITEMS

Backup alarm	Working
Seat belt	Available
Horn	Working
Beacon	Working

TYRES

FRONT LEFT

Tread dept in mm	48mm
Percentage life remaining	50%

REAR LEFT

Tread dept in mm	76mm
Percentage life remaining	80%

REAR RIGHT

Tread dept in mm	81mm
Percentage life remaining	85%

FRONT RIGHT

Tread dept in mm	64mm
Percentage life remaining	70%

New/Excellent



Very good



Good



Fair



Poor



Copyright Smitma BV

