


## CATERPILLAR CS76 XT

### Description

Caterpillar CS76XT, Caterpillar , C6.6, 129.5 kW, CE, Erops cabin, 23.1-26, Frequency meter, Air conditioning, Backup alarm, Beacon, Hours certified by Caterpillar, In very good and clean condition.

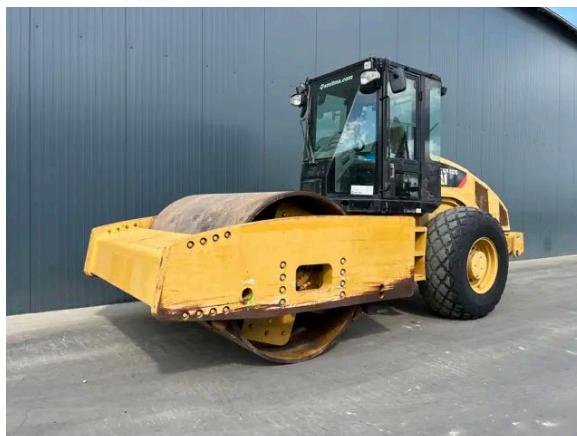

Year	2011
Hours	4378
Weight	18800 kg
Serial number	CAT0CS76ECYX00632
Reference	207608

[Download photos](#)


CONTACT US:  
SALES@SMITMA.COM  
+31(0)773999840

New/Excellent  
★★★★★

Very good  
★★★★☆

Good  
★★★☆☆

Fair  
★★★☆☆

Poor  
★★★☆☆

# INSPECTION REPORT

## FEATURES

Engine brand	Caterpillar
Engine model	C6.6
Engine power in kW	129.5 kW
CE	✓
Tyre size	23.1-26
Beacon	✓
Overall condition	In very good and clean condition.

## DOCUMENTS

Parts book	✓
Operation manual	✓

## GENERAL APPEARANCE

Stamped serial number checked	Yes
Serial number plate checked	Yes
Paint	★★★★★
Decals	★★★★★
Bonnet	★★★★★
Steps/ladders	★★★★★
Cabin	★★★★★

## ENGINE DETAILS AND CONDITION

Engine number	C6E34106
Air cleaner	New
Anti-freeze level °C	-31°C
Diesel anti-freeze added	Yes
Diesel level ok	Yes
Cooling liquid level ok	Yes
Engine oil level ok	Yes
Exhaust manifold	★★★★★
Muffler	★★★★★
Exhaust stack	★★★★★
Hoses	★★★★★
Good cold start	Yes
Engine power	★★★★★

Blow by	★★★★★
Knocking	No
Compression in the radiator	No
Water in the oil	No
Oil in the water	No
Smoke	Normal
Engine leaks	No
Belts and pulleys	★★★★
Fan	★★★★★
Radiator	★★★★★

## SAFETY ITEMS

Backup alarm	Working
Seat belt	Available
Horn	Working
Parking brake	Working
Beacon	Not Working

## OPERATOR STATION

Hourmeter	Working, hours certified by Caterpillar
Air conditioning	Working
Heater	Working
Gauges	Working
Switches	★★★★
Warnings	No warnings available
Mirrors	Not broken
Cabin glass	Not broken
Windshield wipers	Working
Interior lights	Working
Cabin floor	★★★★★
Interior roof	★★★★
Seat	★★★★

## DRUM

Vibratory system	★★★★★
Drum surface	★★★★
Rubber mounts	★★★★★
Drum scrapers	★★★★★
Leakages	No

Drum oil level ok	Yes
Vibration	High and low vibration frequency working

## STEERING

Articulate cylinder leaking	No
Play articulate cylinder	★★★★
Play articulating point	★★★★

## HYDRAULICS

Hydraulic oil level ok	Yes
Hydraulic lines and fittings	★★★★
Hydraulic tank/sight glass and cap	★★★★
Noise hydraulic pump normal	Yes
Operating condition hydraulics	★★★★

## DRIVE CHAIN

Oil level rear axle ok	Yes
Rear axle leakages	No
Wheel bolts and rims	★★★★
Travel motors	★★★★
Oil level left final drive ok	Yes
Left final drive leaking	No
Oil level right final drive ok	Yes
Right final drive leaking	No

## ELECTRICAL, STARTING AND CHARGING SYSTEM

Alternator functioning	Yes
Wiring	★★★★
Batteries	★★★★
Starter	★★★★
Cabin lights working	Few lights don't work
Tail lights working	Yes
Additional work lights working	Few lights don't work

## TYRES

REAR LEFT TYRES	
Tread dept in mm	9mm
REAR RIGHT TYRES	

Tread dept in mm

9mm

New/Excellent ★★★★★	Very good ★★★★☆	Good ★★★☆☆	Fair ★★★☆☆	Poor ★☆☆☆☆
------------------------	--------------------	---------------	---------------	---------------

Copyright Smitma BV

